

SOUTH PACIFIC

Jeppesen NavData CHANGE NOTICES highlight only **significant** changes affecting Jeppesen navigation data that may be currently stored in your aircraft navigation system database.

IMPORTANT: CHECK FOR NOTAMS AND OTHER PERTINENT INFORMATION PRIOR TO FLIGHT.

**FOR NavData BASE
12 Jun 25 THRU 09 Jul 25 CYCLE 2506**

NAVAID

BIAK NDB 'ZM' 230KHz UNSERVICEABLE. REFER SUP 052-24 AIRAC.

KASIGUNCU 'PSJ' VOR/DME FREQ 112.8 MHz/CH75X operates for ground check only due to awaiting flight check. Refer SUP 009-25 AIRAC.

KUABANG KAO VOR/DME 113.7 MHz CH-84X unserviceable due to technical reason. Refer SUP 042-25 AIRAC. Eff 10 Jul 25.

KUANTAN DVORTAC 'VKN' 113.7MHz CH84X, DME-PART AND TACAN-PART U/S. REFER SUP 060-24.

MAUMERE 'MOF' VOR/DME 114.5 MHz, VOR PART IS UNSERVICEABLE DUE TO TECHNICAL REASON. REFER AIP SUP 039-24 AIRAC.

ENROUTE

PAPUA NEW GUINEA

RESTRICTED AREA AYR922 estbld. A circle with a 0.11 NM radius centered on S09 25 48.19 E147 11 18.07. Altitudes: GND - 1000 AGL (S09 E147).

TERMINAL

AUSTRALIA

NEW SOUTH WALES

YSNW, Nowra Military

Nowra, Apch proc ILS-X or LOC-X Rwy 21 USING NWR TACAN OR INA DME, MAX IAS at HOLDING 15 TAC R-031 wpt D031O should read 210kt until 10 JUL 25.

NORTHERN TERRITORY

YPTN, Tindal (Military)

Katherine, RWY 14/32 is unserviceable from 21 MAR 2025 until 01 APR 2026.

INDONESIA

WABB, Frans Kaisiepo

Biak, Apch Proc NDB Rwy 11 not usable until 28 Nov 26.

WAEK, Kuabang

Kao, Apch Procs VOR Y Rwy 36, VOR Z Rwy 36 not usable due to VOR/DME KAO unserviceability, until 10 July 2026.

WAFF, Mutiara Sis Al Jufri

Palu, MALS Rwy 33 is unserviceable due to technical reason. Refer SUP 037-25 AIRAC.

WAFO, Morowali

Morowali, The construction of runway extension along 1476' (450 m) before THR Rwy 23, time schedule 0800-2200Z. All traffic shall observe before take off and landing.

WAGI, Iskandar

Pangkalanbun, ILS Rwy 31 Apch Proc not usable until 05 DEC 25.

PALS CAT I RWY 31 UNSERVICEABLE. REFER SUP 053-24 AIRAC.

WAKT, Tanah Merah

Boven Digoel, Rwy edge light, Thr light, and Rwy end light 07/25 are unserviceable due to technical reasons. Refer SUP 016-25 AIRAC.

WALS, Aji Pangeran Tumenggung Pranoto

Samarinda, RTIL Rwy 04/22 are unserviceable due to damage to the power cable line. Refer SUP 019-25 AIRAC.

WAMI, Bolaang Mongondow

Bolaang Mongondow, PAPI RWY 29 IS UNSERVICEABLE DUE TO TECHNICAL REASON. REFER SUP 045-24 AIRAC.

WAMM, Ratulangi

Manado, SIDs ARITO 1E [ARIT1E], BONDA 2C [BOND2C], DIANI 1E [DIAN1E], HALMO 2C [HALM2C], LUANG 2A [LUAN2A], RUMBO 2A [RUMB2A], SOSOK 2A [SOSO2A]: MAX 185 KT during initial turn (heading 283°), no speed limitat Wpt MM444 until 10 Jul 25.

SIDs ARITO 1F [ARIT1F], DIANI 1F [DIAN1F], GONTA 2B [GONT2B], GOTSA 2B [GOTS2B], HALMO 2D [HALM2D], LUANG 2B [LUAN2B], NITIP 1E [NIT1E], PEDNO 1E [PEDN1E], RUMBO 2B [RUMB2B], SOSOK 2B [SOSO2B]: No Alt restriction at D1.5 MNO until 10 Jul 25.

SIDs ARITO 1F [ARIT1F], DIANI 1F [DIAN1F], GONTA 2B [GONT2B], GOTSA 2B [GOTS2B]: MAX 185 KT during initial turn (heading 290°), no speed limit until establishing heading 200° until 10 Jul 25.

SIDs BONDA 2C [BOND2C], HALMO 2C [HALM2C], LUANG 2A [LUAN2A], RUMBO 2A [RUMB2A], SOSOK 2A [SOSO2A]: Alt restriction at Wpt MM444 should read "at or above" 5000' until 10 Jul 25.

SOUTH PACIFIC

SIDs HALMO 2D [HALM2D], LUANG 2B [LUAN2B],
NITIP 1E [NIT1E], PEDNO 1E [PEDN1E],
RUMBO 2B [RUMB2B], SOSOK 2B [SOSO2B]:
MAX 185 KT during initial turn (heading 290°), no
speed limit until establishing altitude "at or above"
5000' until 10 Jul 25.
STARs ARITO 1G [ARIT1G], DIANI 1G [DIAN1G],
GONTA 2E [GONT2E], GOTSA 2E [GOTS2E]:
Holding NOKOV inbound course should read 148°
and outbound course should read 328° until 10 Jul
25.

WAMP, IMP

Morowali, RWY 13 DECLARED DISTANCES
TODA 6201' (1890m), CWY NIL, DUE TO
CONSTRUCTION. REFER SUP 024-25 AIRAC.
Thr light Rwy 13/31, RTIL Rwy 13/31, Rwy edge
light, Rwy end light 13/31, Twy edge light, apron
floodlight, and PAPI Rwy 13/31 are unserviceable
due to displacement reason. Refer SUP 024-25
AIRAC.

WAQT, Kalimarau

Tanjung Redeb, Until 31 DEC 2027 IBRZ
Instrument Landing System (ILS) and Glide Path
(GP) are unserviceable due to technical reasons.

WARR, Juanda

Surabaya, ApcH Proc ILS or LOC Rwy 10 not usable
until 20 Jul 25.
ILS/LOC 'ISBY' 110.10MHz UNSERVICEABLE DUE
TO REPLACEMENT. REFER AIP SUP 006-25
AIRAC.

Rwy 10/28 closed daily at 1700-2159 due to work in
progress. Exc for MIL flight exercise and medivac
helicopter. Not permitted to plan as an alternate
airport. Heavy equipment present. Refer SUP
020-25 AIRAC.

WASS, Domine Eduard Osok

Sorong, ApcH Proc VOR Rwy 09 not usable until 31
Mar 26.

WATC, Fransiskus Xaverius Seda

Maumere, ApcH Proc VOR Rwy 23 is not usable
until 31 Oct 25.

WATR, David Constantijn Saudale

Rote Ndao, THR Light Rwy 04/22, RTIL Rwy 22,
Turn Pad Light Rwy 04, Rwy End Light 04/22,
Rwy Edge Light 04/22 and Twy Edge Light are
unserviceable due to technical reason.

WAWB, Betoambari

Baubau, RNP Rwy 04 ApcH Proc is not usable until
31 Dec 25.

WIDT, Raja Haji Abdullah

Tanjung Balai Karimun, Rwy Threshold
Identification Lights (RTIL), Rwy Edge, Rwy
Threshold, Rwy End Lights Rwy 09/27, and
Twy Edge Lights are unserviceable. Refer SUP
047-25 AIRAC. Eff 10 Jul 25.

WIII, Soekarno-Hatta Intl

Jakarta, ILS or LOC Rwy 24 ApcH Proc not usable
until 05 SEP 25.

WIJJ, Sultan Thaha

Jambi, APPROACH LIGHTING FOR RWY 31 AND
RUNWAY END IDENTIFIER LIGHTS (REIL)
FOR RWY 13 ARE UNSERVICEABLE DUE TO
TECHNICAL REASON. REFER SUP 048-24
AIRAC.

WIKT, H.AS. Hanandjoeddin

Belitung, The sequence flashing light is
unserviceable due to maintenance. Refer SUP
011-25 AIRAC.

WIOO, Supadio

Pontianak, ApcH Proc ILS or LOC Rwy 15 is not
usable until 17 Apr 26.

ILS/LOC 'IPNK' 111.3 MHz UNSERVICEABLE DUE
TO REPLACEMENT. REFER AIP SUP 026-25
AIRAC.

MALAYSIA

WBGB, Bintulu

Bintulu, ApcH Proc RNP Y Rwy 17: FAF Ident
should read GB510. Database will be updated for
cycle 2507, Eff. 10 Jul 25.

WBKK, Kota Kinabalu

Kota Kinabalu, ApcH Proc suspended due to
obstacles:
LOC Z Rwy 02,
VOR Z Rwy 02,
LOC Z Rwy 20,
LOC Y Rwy 20,
VOR Z Rwy 20,
VOR Y Rwy 20.
ApcH Proc available:
ILS Z Rwy 02,
ILS Z Rwy 20,
ILS Y Rwy 20.

WBKL, Labuan I

Labuan I, ILS Rwy 14 UNSERVICEABLE. REFER
AIP SUP 068-24 AIRAC.

WMKK, Kuala Lumpur Intl - Sepang

Kuala Lumpur, ACFT STAND J18, J20 AND J22
TEMPORARILY CLOSED. REFER SUP 012-25
AIRAC.

RNP SIDs ATIMU 2A[ATIM2A] ATIMU 2B[ATIM2B]
ATIMU 2C[ATIM2C] ATIMU 2D[ATIM2D]
ATIMU 2E[ATIM2E] ATIMU 2F[ATIM2F]
BIKDU 2A[BIKD2A] BIKDU 2B[BIKD2B]
BIKDU 2C[BIKD2C] BIKDU 2D[BIKD2D]
BIKDU 2E[BIKD2E] BIKDU 2F[BIKD2F]
IBUKU 2A[IBUK2A] IBUKU 2B[IBUK2B]
IBUKU 2C[IBUK2C] IBUKU 2D[IBUK2D]
IBUKU 2E[IBUK2E] IBUKU 2F[IBUK2F]
KIMAT 2A[KIMA2A] KIMAT 2B[KIMA2B]
KIMAT 2C[KIMA2C] KIMAT 2D[KIMA2D]
KIMAT 2E[KIMA2E] KIMAT 2F[KIMA2F] MITOS
2A[MITO2A] MITOS 2B[MITO2B] MITOS
2C[MITO2C] MITOS 2D[MITO2D] MITOS
2E[MITO2E] MITOS 2F[MITO2F] RUSBU
2A[RUSB2A] RUSBU 2B[RUSB2B] RUSBU
2C[RUSB2C] RUSBU 2D[RUSB2D] RUSBU
2E[RUSB2E] RUSBU 2F[RUSB2F] PIBOS
2A[PIBO2A] PIBOS 2B[PIBO2B] PIBOS
2C[PIBO2C] PIBOS 2D[PIBO2D] PIBOS
2E[PIBO2E] PIBOS 2F[PIBO2F] PUGER
2A[PUGE2A] PUGER 2B[PUGE2B] PUGER
2C[PUGE2C] PUGER 2D[PUGE2D] PUGER
2E[PUGE2E] PUGER 2F[PUGE2F] SALAX
2A[SALA2A] SALAX 2B[SALA2B] SALAX
2C[SALA2C] SALAX 2D[SALA2D] SALAX
2E[SALA2E] SALAX 2F[SALA2F] suspended,
UFN.

SOUTH PACIFIC

NEW CALEDONIA

NWWW, Tontouta

Noumea, STARs ADKAD 2 [ADKAD2], GOPRA 2 [GOPRA2], MESUS 2 [MESUS2], NIPOG 2 [NIPOG2], NISAS 2 [NISAS2], ONIBA 2 [ONIBA2], POXAK 2 [POXAK2], PULON 2 [PULON2], SCUBA 2 [SCUBA2], TEPAM 2 [TEPAM2], VIRAR 2 [VIRAR2]: Holding LTO (Inbound course 285°, Min Alt 6000') Turn Direction should read Left until 10 Jul 25.

NEW ZEALAND

NZCH, Christchurch Intl

Christchurch, Apch Procs VOR DME RWY 20 and VOR DME S RWY 20 unavailable when crane testing site active. Crane testing area approximately 1.7 NM to the NE of RWY 20 threshold, UFN.

PAPUA NEW GUINEA

AYKV, Kavieng

Kavieng, RNAV (GNSS) Rwy 30 Apch Proc is not available in the database due to significant threshold coordinates change, UFN.

AYMO, Momote

Momote, Approach proc NDB not available per NDB MOE withdrawal

AYPY, Jacksons

Port Moresby, SIDs GUNKI 1 [GUNKI1], LOTGU 1 [LOTGU1], NUPTA 1 [NUPTA1], ODOGA 1 [ODOGA1], RUKVI 1 [RUKVI1], STARF 1 [STARF1], TOMOM 1 [TOMOM1], UNSAM 1 [UNSAM1] not available, Est 09 Sep 25.

STARs ENTOG 1A [ENTO1A], ENTOG 1B [ENTO1B], GUMBU 1 [GUMBU1], LOTGU 1 [LOTGU1], MUDOV 1 [MUDOV1], NUPTA 1 [NUPTA1], SAKTO 1 [SAKTO1], UNSAM 1 [UNSAM1] not available, Est 09 Sep 25.

SINGAPORE

WSSS, Changi

Singapore, SIDs VOVOS 1B [VOVO1B], VOVOS 1D [VOVO1D] and VOVOS 1F [VOVO1F] are not available for flight planning, UFN.

SOUTH PACIFIC

INTENTIONALLY LEFT BLANK